



Alberta Boilers Safety Association

REFERENCE SYLLABUS

**for
GRADE "B"
PRESSURE WELDER'S**

**CERTIFICATE of COMPETENCY
EXAMINATION**

2002
1996
1985

ABSA OFFICE LOCATIONS

Edmonton (Head Office)	#200, 4208 - 97 Street Edmonton, Alberta T6E 5Z9 Tel. (780) 437-9100 Fax (780) 437-7787
Calgary	Tower 3, #590 1212-31 Avenue, N.E. Calgary, Alberta T2E 7S8 Tel. (403) 291-7070 Fax (403) 291-4545
Grande Prairie	Room 203, 10109 - 97 Avenue Grande Prairie, Alberta T8V 0N5 Tel. (780) 538-9922 Fax (780) 538-9400
Lethbridge	#300, 515-7 Street, South Lethbridge, Alberta T1J 2G8 Tel. (403) 381-5465 Fax (403) 327-2483
Medicine Hat	#103, 346 - 3rd Street S.E. Medicine Hat, Alberta T1A 0G7 Tel. (403) 529-3520 / (403) 529-3514 Fax (403) 529-3623 / (403) 529-3632
Red Deer	#402, 4406 Gaetz Avenue Red Deer, Alberta T4N 3Z6 Tel. (403) 341-6677 Fax (403) 341-3377
Fort McMurray	#204, 9913 Biggs Avenue Fort McMurray, Alberta T9H 1S2 Tel. (780) 714-3067 Fax (780) 714-2380
Internet Address	http://www.absa.ca

GENERAL INFORMATION

INTRODUCTION:

This Syllabus is intended to assist candidates preparing for the Grade "B" Pressure Welder's Certificate of Competency Examination.

ELIGIBILITY:

To qualify to take a Grade 'B' Pressure Welder's Certificate of Competency examination, a candidate must:

- a. hold a Journeyman Certificate of Proficiency issued under the *Apprenticeship and Industry Training Act*, **or**
- b. hold a Journeyman Welder's Interprovincial Red Seal Certificate of Competency from another jurisdiction, **or**
- c. hold an Alberta Journeyman Equivalency Document issued by Alberta Career Development and Employment.

To pass a Grade 'B' Pressure Welder's Certificate of Competency examination, a candidate must pass the performance qualification test required by the Administrator and conducted by a Safety Codes Officer.

APPLICATION TO UNDERTAKE EXAMINATION:

A candidate for examination shall, at least seven days before the examination date, deliver to the Safety Codes Officer, an application on the form prescribed by the Administrator.

Each person applying to take an examination shall pay the specified fee.

The candidate must show picture I.D. and eligibility documentation at the examination.

GRADE 'B' PRESSURE WELDER PERFORMANCE QUALIFICATION TEST

The following procedure outlines the manner in which the performance qualification tests will be conducted by Alberta Boilers Safety Association for the Grade 'B' Pressure Welder's Certificate of Competency.

Test Coupon:

The test coupon will be a 6 inch diameter schedule, 80 carbon steel seamless pipe and prepared with a 32 degree bevel to a feather edge.

Test Positions:

One-quarter (1/4) of the coupon circumference will be welded in the 2G position and the remaining portion in the 5G position.

Electrodes:

The electrodes used for the test shall be:

E-6010 (1/8" diameter) for the root pass and
E-7018 (3/32" & 1/8" diameters) for the fill and cap passes

Examination Time:

Candidates will have 3.5 hours to prepare, tack and weld the test coupons, and one (1) hour to prepare the bend specimens.

Preparation and Tacking:

When preparing coupons for tacking, the size of the root face (land) and the width of the root gap (spacing) shall be at the candidate's discretion. The four tack welds are to be made using the E-6010 electrode and should be approximately 1/2" in length. All tack welds shall be of good quality, as they are considered part of the weld. After tacking the coupon, candidates may feather the tacks prior to the coupon being presented to the Examiner.

Welding:

After the candidate completes tacking of the coupon, it will be presented to the Examiner. The Examiner will then mark the portion of the coupon that is to be welded in the horizontal (2G) with the remainder to be used for the 5G position weld.

The candidate will then weld the horizontal (2G) root pass, using an E-6010 electrode with the pipe axis in the vertical plane. When the candidate completes the 2G root pass, the coupon shall be presented to the Examiner for evaluation.

Providing the 2G root pass is acceptable, the coupon shall then be placed in the 5G position (pipe axis in the horizontal plane) with one end of the completed 2G root placed at the top (12:00). The candidate will alert the Examiner to then mark the position and height of the coupon. Once the coupon is positioned for welding, the marked coupon and positioner shall not be moved. The candidate will then weld the 5G portion of the root pass with an E-6010 electrode with the welding progression upward. The candidate will present the coupon to the Examiner for evaluation upon completion of the 5G root pass.

If the root pass proves to be acceptable, the candidate shall complete the fill and cap passes of the 5G position weld using an E-7018 electrode with an upward progression and weave pattern. The candidate will present the coupon to the Examiner for evaluation upon completion. The coupon will then be repositioned (axis in vertical plane) to complete the 2G positional fill and capping using stringers and an E-7018 electrode. The candidate will present the coupon to the Examiner for evaluation upon completion.


Bend Specimens:

Four face and four root bend test specimens are required for this combined position. Test specimens will be marked on the coupon by the Examiner as per the following sketch. The specimens should be approximately 1.5" in width and ground flush on both side with edges deburred. Candidates may radius the corners of the specimens to 1/8" maximum.

Excessive grinding that reduces the thickness of the specimens below the nominal thickness shall result in the test being considered as a failure.

Bend Specimen Locations

F - Flat
H - Horizontal
V - Vertical
O - Overhead

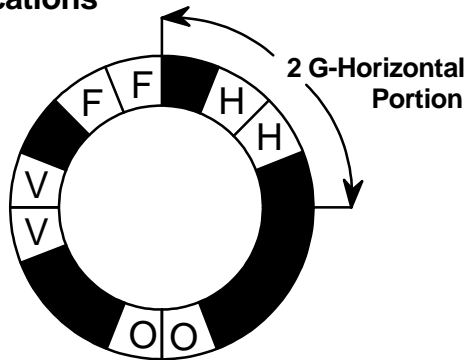

Required Standards:

The root pass shall be of uniform width and the penetration, neither excessive nor inadequate.

All welds shall be free of grapes, craters, porosity, undercut, and lack of fusion.

The finished weld shall be uniform, free from undercut or arc strikes. Excessive weld reinforcement is not permitted and the weld cap must not exceed 3/32".

The guided bend tests shall have no open defects in the weld or heat affected zone exceeding 1/8" measured in any direction on the convex surface of the specimen. Open defects occurring on the corners of the specimen during bending shall not be considered, unless there is evidence that they result from slag inclusions, lack of fusion, or other internal defects.

The failure of any bend specimen shall be considered as a complete failure of the test.

The performance test may be terminated at any stage of review, if it becomes apparent that the candidate does not have the required skill to produce satisfactory results, or is taking an excessive length of time to complete any phase of the test.

NOTES:

Candidates successful in passing this examination will be issued:

1. a Certificate of Competency as Grade B Pressure Welder;
2. an initial performance qualification card valid for two years from date of issuance

Candidates failing the examination:

A candidate failing to pass any performance qualification test conducted by a Safety Codes Officer shall not be permitted to take a re-test for a period of one month from the date of the test, unless permitted to do so by a Safety Codes Officer.

A candidate failing to pass two consecutive performance qualification tests conducted by a Safety Codes Officer, shall not be permitted to take a further retest for a period of 3 months from the date of his last test, unless the welder provides proof of having successfully completed an upgrading course in Pressure Welding satisfactory to the Administrator.